



#### **TEST REPORT**

**Report No.**: D6387.01-301-47

#### Rendered to:

CR LAURENCE CO., INC. Vernon, California

**PRODUCT TYPE**: Architectural Terrace Door (In-Swing) **SERIES/MODEL**: 900

**SPECIFICATION**: AAMA/WDMA/CSA 101/I.S.2/A440-08, NAFS - North American Fenestration Standard/Specification for Windows, Doors, and Skylights.

Title	Summary of Results
	Class AW – PG40: Size Tested
Primary Product Designator	1219 x 2438 mm (48 x 96 in.)
	– Type ATD
Design Pressure	±1920 Pa (±40.10 psf)
Air Infiltration	0.5 L/s/m <sup>2</sup> (0.10 cfm/ft <sup>2</sup> )
Water Penetration Resistance Test Pressure	390 Pa (8.15 psf)

**Test Completion Date**: 08/22/2014

Reference must be made to Report No. D6387.01-301-47, dated 02/12/15 for complete test specimen description and detailed test results.





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

Page 1 of 8

**1.0 Report Issued To**: CR Laurence Co., Inc.

2100 East 38th Street Vernon, California 90058

**2.0 Test Laboratory**: Architectural Testing, Inc.

4 Rancho Circle

Lake Forest, California 92630

949-460-9600

#### 3.0 Project Summary:

**3.1 Product Type**: Architectural Terrace Door (In-Swing)

**3.2 Series/Model**: 900

**3.3 Compliance Statement**: Results obtained are tested values and were secured by using the designated test methods. The specimen tested successfully met the performance requirements for a **Class AW – PG40**: **Size Tested 1219** x **2438** mm **(48** x **96** in.) – **Type ATD** rating.

**3.4 Test Dates**: 08/14/2014-08/22/2014

- **3.5 Test Location**: C.R. Laurence's test facility in Los Angeles, California. Calibration of test equipment was performed by Architectural Testing in accordance with AAMA 205-01 "In-Plant Testing Guidelines for Manufacturers and Independent Laboratories".
- **3.6 Test Sample Source**: The test specimen was provided by the client. Representative samples of the test specimen will be retained by Architectural Testing for a minimum of four years from the test completion date.
- **3.7 Drawing Reference**: The test specimen drawings have been reviewed by Architectural Testing and are representative of the test specimens reported herein. Test specimen construction was verified by Architectural Testing per the drawings located in Appendix C. Any deviations are documented herein or on the drawings.

#### 3.8 List of Official Observers:

<u>Name</u> <u>Company</u>

Marco Ramirez CR Laurence Co., Inc. Jarod S. Hardman Architectural Testing, Inc.





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

Page 2 of 8

## **4.0 Test Specifications**:

AAMA/WDMA/CSA 101/I.S.2/A440-08, NAFS - North American Fenestration Standard/Specification for Windows, Doors, and Skylights.

AAMA 910-10, Voluntary "Life Cycle" Specifications and Test Methods for AW Class Architectural Windows and Doors.

## **5.0 Test Specimen Description:**

#### **5.1 Product Sizes:**

Overall Area:	Width		Height	
2.97 m <sup>2</sup> (32.0 ft <sup>2</sup> )	millimeters	inches	millimeters	inches
Overall size	1219	48	2438	96
Leaf	1181	46-1/2	2368	93-1/4

#### **5.2 Frame Construction:**

Frame Member	Material	Description
Threshold	Thermally broken	Union of Die #H-61266 and Die #HE454 with
Tillesiloid	aluminum	thermal break Die #279300.
Thermally broken		Union of Die #H-61266 and Die #H-61265 with
Head	aluminum	thermal break Die #279300.
Thermally broken		Union of Die #H-61264 and Die #H-61263 with
Jambs	aluminum	thermal break Die #279300.

	Joinery Type	Detail
All corners	Coped	Secured through jamb at each corner into screw boss with two #12 x 1" Hex head screws, and then corner joint is capped with 2" x 2" x 4-1/2" corner cap 1/32" thick is silicone sealed over the corner joint.





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

Page 3 of 8

# **5.0 Test Specimen Description**: (Continued)

## **5.3** Leaf Construction:

Leaf Member	Material	Description
Top rail, bottom	Thermally broken	Union of Die #H-61273 and Die #H-61272 with
rail, stiles	aluminum	thermal break Die #279300.

	Joinery Type	Detail
All corners	Mitered	Secured at corners with aluminum corner key, Die #H80000, that is secured to rails and stiles with three dimples in the aluminum to retain the key.

## **5.4 Weatherstripping**:

Description	Quantity	Location
Hollow bulb gasket (see	1 row	Inserted into channel of frame full
attached drawing #USA-2964)	1 row	perimeter.
Foam filled bulb gasket (see	1 row	Inserted in channel of leaf full
attached drawing #USA-1820)	110W	perimeter.

## 5.5 Glazing:

Glass Type	Spacer Type	Interior Lite	Exterior Lite	Glazing Method
1" IG	Aluminum A1-D1	1/4" clear tempered	1/4" clear tempered	Interior tape glazed with 3/8" x 1/8" tape and a cap bead at exterior side and secured at interior with glazing bead (See attached Drawing #60939) and rubber wedge gasket (see attached Drawing #USA-1819B)

Location	Quantity	Daylight Opening millimeters inches		Glass Bite
Location	Quantity			Glass bite
Leaf	1	994 x 2180	39-1/8 x 85-13/16	1/2"





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

Page 4 of 8

# **5.0 Test Specimen Description**: (Continued)

## **5.6 Drainage:**

<b>Drainage Method</b>	Size	Quantity	Location
Weep hole	1-3/4" x 1/4"	1	Mid-span of threshold at exterior face.
Weep hole	3/4" x 1/8"	2	1" from each end of glazing pocket of bottom rail of leaf.

#### **5.7 Hardware**:

Description	Quantity	Location	
Hoppe Athinai M156/216N handle assembly	1	Located 36" from sill and secured to lock stile with three #10 x 2-1/2" Phillips oval head screws.	
Handle/deadbolt strike	1	Located directly opposite handle assembly on lock jamb and secured with three #10 x 1/2" Phillips flat head screws (see attached Drawing #900-40).	
Hoppe active tongue system	1	One tongue located 12" from sill and the other tongue located 30" from head on leaf lock stile, system was secured to stile with #8 x 1" Phillips flat head screws 6" on center spacing of full length of stile.	
Tongue strike	2	Located directly opposite tongue on lock jamb and secured with two #10 x 1/2" Phillips flat head screws (see attached drawing #900-42B).	
Shoot bolt strike	2	Located directly opposite shoot bolt in corner of head and sill at lock jamb and secured to head and sill with two #10 x 1/2" Phillips flat head screws (see attached drawing #900-43C).	
Butt hinge	4	Located 8-3/4" from sill and 26-1/4" on center, secured to frame jamb with four #12-24 x 7/8" Phillips flat head screws and to leaf stile with four #12 x 1" Phillips pan head screws (see attached drawing #900-24B).	





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

Page 5 of 8

## **5.0 Test Specimen Description**: (Continued)

#### **5.8 Reinforcement:**

Drawing Number	Location	Material
C-1253	Inserted into corner joints of leaf assembly.	Aluminum

#### **5.9 Screen Construction**: No screen was utilized.

#### **6.0 Installation**:

The specimen was installed into a Pine wood buck. The rough opening allowed for a 3/8" shim space. The exterior and interior perimeters of the door frame were sealed with structural silicone sealant.

Location	Anchor Description	Anchor Location		
Full perimeter	#12 x 2" Phillips flat head screw	6" from corners and 12" on		
		center		





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

Page 6 of 8

# **7.0 Test Results**: The temperature during testing was 29°C (84°F). The results are tabulated as follows:

Title of Test	Results	Allowed	Note		
Title of Test	Force to latch:	Alloweu	Note		
	40.0 N (9.0 lbf)	Report Only			
	Deadbolt:	Report only			
Operating Force,	4.5 N/m (1.0 lbs/in)	Report Only			
Force to latch test procedure,	Force for deadbolt:	report only			
per AAMA 101	0 N (0.0 lbf)	Report Only			
	Force for secondary:	110 p 0110 0 111.			
	40.0 N (9.0 lbf)	Report Only			
Air Leakage,					
Infiltration per ASTM E 283	0.5 L/s/m <sup>2</sup>	0.5 L/s/m <sup>2</sup>			
at 300 Pa (6.27 psf)	$(0.10 \text{ cfm/ft}^2)$	$(0.10 \text{ cfm/ft}^2) \text{ max.}$	1		
Water Penetration,		, ,			
per ASTM E 547 and ASTM E 331					
at 390 Pa (8.15 psf)	Pass	No leakage			
I	i <b>fe Cycle</b> per AAMA 910				
Door Leaf Cycling,					
(First half)					
per AAMA 910					
12,500 cycles	Pass	No damage			
Locking Hardware Cycling,					
(First half)					
per AAMA 910					
2000 cycles	Pass	No damage			
	use Testing per AAMA 9	910	1		
Door Leaf Vertical Load	D	NT 1			
at 890 N (200 lbf)	Pass	No damage			
Door Leaf Corner Block	D	Ma danaa			
at 334 N (75 lbf)	Pass	No damage			
Life Cycle per AAMA 910					
Door Leaf Cycling,					
(Second half) per AAMA 910					
12,500 cycles	Pass	No damage			
Locking Hardware Cycling,	г dSS	ivo udiliage			
(Second half)					
per AAMA 910					
2000 cycles	Pass	No damage			
=000 cy cico	1 400	110 dalliage	l		





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

Page 7 of 8

## 7.0 Test Results: (Continued)

Title of Test	Results	Allowed	Note
	Force to latch:		
	40.0 N (9.0 lbf)	Report Only	
On anating Fauga	Deadbolt:		
Operating Force,	4.5 N/m (1.0 lbs/in)	Report Only	
Force to latch test procedure, per AAMA 101	Force for deadbolt:		
per AAMA 101	0 N (0.0 lbf)	Report Only	
	Force for secondary:		
	40.0 N (9.0 lbf)	Report Only	
Uniform Load Deflection,			
per ASTM E 330			
taken at top rail			
+1920 Pa (+40.10 psf)	1.3 mm (0.05")	6.1 mm (0.24") max.	
-1920 Pa (-40.10 psf)	1.0 mm (0.04")	6.1 mm (0.24") max.	2, 3
Air Leakage,			
Infiltration per ASTM E 283	0.4 L/s/m <sup>2</sup>	$0.5 \text{ L/s/m}^2$	
at 300 Pa (6.27 psf)	(0.08 cfm/ft <sup>2</sup> )	(0.10 cfm/ft <sup>2</sup> ) max.	1
Water Penetration,			
per ASTM E 547 and ASTM E 331			
at 390 Pa (8.15 psf)	Pass	No leakage	
Uniform Load Structural,			
per ASTM E 330			
taken at top rail			
+2880 Pa (+60.15 psf)	0.3 mm (0.01")	2.3 mm (0.09") max.	
-2880 Pa (-60.15 psf)	0.0 mm (0.00")	2.3 mm (0.09") max.	2, 3
Forced Entry Resistance,			
per AAMA 1304	Pass	No entry	

Note 1: The tested specimen meets (or exceeds) the performance levels specified in AAMA/WDMA/CSA 101/I.S.2/A440 for air leakage resistance.

Note 2: Loads were held for 10 seconds.

Note 3: Tape and film were used to seal against air leakage during structural testing. In our opinion, the tape and film did not influence the results of the test.

**General Note**: *The door was tested in accordance with the venting use classification.* 





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

MANIE

Page 8 of 8

The service life of this report will expire on the stated Test Record Retention End Date, at which time such materials as drawings, data sheets, samples of test specimens, copies of this report, and any other pertinent project documentation, shall be discarded without notice.

If test specimen contains glazing, no conclusions of any kind regarding the adequacy or inadequacy of the glass in any glazed test specimens can be made. This report does not constitute certification of this product nor an opinion or endorsement by this laboratory. It is the exclusive property of the client so named herein and relates only to the specimens tested. This report may not be reproduced, except in full, without the written approval of Architectural Testing, Inc.

For ARCHITECTURAL TESTING, Inc.

Digitally Signed by: Jarod Hardman

Jarod S. Hardman Laboratory Manager Digitally Signed by:Kenny C. White

Kenny C. White Laboratory Manager

JSH:ss

Attachments (pages): This report is complete only when all attachments listed are included.

Appendix-A: Alteration Addendum (1)

Appendix-B: Photographs (2) Appendix-C: Drawings (27)





Report Date: 10/03/14
Revision 1 Date: 02/12/15
Test Record Retention End Date: 08/22/18

## **Revision Log**

<u>Rev. #</u>	<u>Date</u>	Page(s)	Revision(s)
0	10/03/14	N/A	Original report issue.
1	02/12/15	Cover, 1	Corrected PG80 to PG40 to reflect results listed in performance of product.





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18

# Appendix A

## **Alteration Addendum**

**Alteration #1**: Date – 08/22/14

Cause for alteration – Water penetration failure

Remedial action taken - Weep hole flap cover was removed to allow

system to drain more efficiently.





Report Date: 10/03/14
Revision 1 Date: 02/12/15
Test Record Retention End Date: 08/22/18

Appendix B

**Photographs** 





Report Date: 10/03/14
Revision 1 Date: 02/12/15
Test Record Retention End Date: 08/22/18



Photo No. 1 Door Cycling Set-up – Interior



Photo No. 2 Door Cycling Set-up – Exterior





Report Date: 10/03/14 Revision 1 Date: 02/12/15

Test Record Retention End Date: 08/22/18



**Photo No. 3**Door Cycling – Completion of First Half



**Photo No. 4**Door Cycling – Completion of Second Half







Report Date: 10/03/14
Revision 1 Date: 02/12/15
Test Record Retention End Date: 08/22/18

Appendix C

**Drawings** 

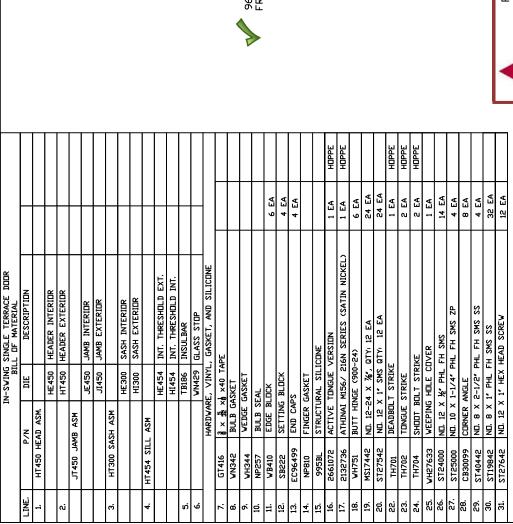

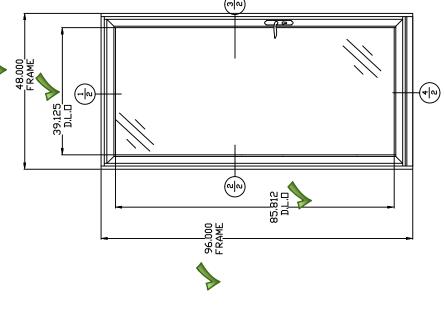



D6387-301-47 10/02/2014 21646

•	<b>₹</b>
	ALUMI

C.R. LAURENCE CD., INC. CRL MANUFACTURING 2100 E. 38TH STREET LDS ANGELES, CA 90058

203

900 IN-SWING SINGLE TERRACE DOOR MACK-UP DRAWING

SYMBOL KEY	DESCRIPTION	1. INSULATED GLASS 1. 1/4. CLEAR TEMPERED GLASS 2. 1/4. ALUMINUM SPACER 3. 1/4. CLEAR TEMPERED 4. GLASS SIZE: 40.125' × 86.812'
	SYMBOL	ਓ

THE DESIGN SHOWN	E PROPERTY OF	THEREOF CANNOT BE	TITLE	SING	MA	
THIS DRAVING AND THE DESIGN SHOWN THERIN IS THE PROPERTY OF C.R. LAURENGE C.D., INC. AND USE OR COPIES THEREOF CANNOT BE MADE WITHOUT WRITTEN CONSENT.			DRAWN BY: MR	DATE: 03.04.14	DATE BY SCALE: $\frac{2}{4}$ "=1'-0"	
						ВУ
						DATE
						DESCRIPTION
						REV.
	QTY.	1 EA				

